(WYLER)

WYLER AG Im Hölderli CH-8405 WINTERTHUR Switzerland Tel. 0041 (0) 52 233 66 66 Fax. 0041 (0) 52 233 20 53

Homepage: http://www.wylerag.com E-Mail: wyler@wylerag.com

MANUAL

BlueLEVEL-2D









CONTENT

		SUBJECT	PAGE
			_
1. I	NTRODUC		7
	1.1.	DESCRIPTION OF THE BLUELE VEL-2D	/
	1.2	PREPARATION AND START-UP	/
	1.2.1		/ 0
2		POSSIBLE CONFIGURATIONS	8
2			10
	2.1		10
	2.1.1	HOW TO SWITCH THE INSTOLIMENT ON AND OFF	11
	2.1.2		11
	2.1.0		13
	2.2		13
	2.2.1	DISPLAY TYPES	14
	223	BACKGROUND COLOUR	15
	2.2.4	BRIGHTNESS	16
	2.3	SHORT DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS	17
3 (IG INSTRUCTIONS BLUELEVEL-2D	18
	3.1	"ZERO-SETTING" / ABSOLUTE ZERO	18
	3.1.1	SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)	18
	3.2	SELECTION OF THE MEASURING UNIT / UNIT	20
	3.2.1	Standard-units	20
	3.2.2	UNITS WITH RELATIVE BASE LENGTH	20
	3.3	FUNCTION HOLD	21
	3.4	SELECTION OF THE FILTER UNDER DIFFERENT MEASURING CONDITIONS /	22
		FILTER	
	3.5	ABSOLUTE MEASUREMENT / RELATIVE MEASUREMENT	22
	3.5.1	ABSOLUTE MEASUREMENT	22
	3.5.2	RELATIVE MEASUREMENT / REL ZERO	23
	3.6	MEASURING WITH LIMITS / LIMITS	24
	3.7	GROUPING OF INSTRUMENTS TO A MEASURING GROUP IN THE WIRELESS MODE	26
	3.7.1	GROUPING VIA CABLE CONNECTION / JOIN	26
	3.7.2	GROUPING IN THE WIRELESS MODE / JOIN	26
	3.8	TEACH-IN of the IR-trigger (Zapper)	27
4 (OPTIONS		28
	4.1	SET PIN-CODE	29
	4.2		29
	4.3		30
	4.4		31
	4.0		ు∠ ఎం
	4.0		32 22
	4.7 1 Q		33
	4.0		34
	4.9	RESET OLICK CALIBRATION (ONLY POSSIBLE WITH OLICK CALIBRATION	34
	4.10		7
	4 1 1	FACTORY RESET	35
	4 12		36
APPEN			37
A	LOAT CH	IARTS GENERAL	37
	A1	START THE INSTRUMENT / ON/OFF	37
	A2	KEY REL.ZERO	38
	A3	Key HOLD, Freezing of a measuring value / HOLD	39
	A4	MENU SELECTION	40
	A5	ADJUSTMENT OF THE DISPLAY / DISPLAY	41
	A6	MEASUREMENT ABSOLUTE / MODE ABSOLUTE	42

	A7	MEASURING ABSOLUTE CONSIDERING THE ZERO OFFSET / MODE	43
		ABSOLUTE ZERO	
	A8	MEASURING RELATIVE / MODE REL ZERO	44
	A9	ADJUSTMENT OF THE MEASURING UNIT / UNIT	45
	A1	0 SETTING OF LIMITS/LIMITS	46
	A1	1 ADJUSTMENT OF FILTER TYPES / FILTER	47
	A1	2 GROUPING OF INSTRUMENTS WITH WIRELESS TRANSMISSION / JOIN	48
	A1	3 LEAVING A GROUP OF INSTRUMETNS / LEAVE	49
В	FLOAT	CHARTS OPTIONS	50
	B1	PIN-CODE-QUERY FOR ACCESS TO THE OPTIONS	50
	B2	SET PIN CODE	51
	B3	DISPLAY SETTINGS	52
	B4	LOGARITHMIC SCALE ON/OFF / LOGSCALE ON/OFF	53
	B5	PROGRAMMABLE KEYS "REL ZERO" AND "ZERO/SELECT" /	54
		PROGRAMMABLE KEYS	
	B6	Switching Functions on or off / Functions ON/OFF	55
	B7	SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF /	56
		HIDE DISABLED FUNCTIONS ON/OFF	
	B8	SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFF	57
	B9	SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION	58
		COMPENSATION	
	B1	0 DISPLAY THE FIRMWARE-VERSION / VERSION FIRMWARE	59
	B1	1 RESET TO FACTORY SETTINGS / FACTORY RESET	60
	B1	2 FUNCTION CHECK / DEVICE CHECK	61
С	Error	Messages	62
D	MAINT	ENANCE	62
	D.1	General	62
	D.2	2 STORAGE/ CARE AND HANDLING OF THE BATTERIES	62
	D.3	S Spare Parts / Accessories	62
E CONFORMITY DECLARATIONS AND APPROVALS			
F	F SERVICE AND REPAIR		
	F1 REPAIR OF MEASURING INSTRUMENTS AND DISPLAY UNITS		
	F2	SERVICE - AND MAINTENANCE CONTRACTS	64

Modifications / Änderungen:

Datum /	Geändert durch /	Beschreibung der Änderung /
Date	Modified by	Description of the modification
1.3.2014	HEH	Initial release
12.3.2014	MG	Some corrections
8.1.2015	HEH	New: CONFORMITY DECLARATIONS AND APPROVALS

In the link list below, you will find more information on different important topics :

- Important Product Information (e.g. Important Conformity Declarations and Approvals) http://w w w.w ylerag.com/en/support/certificates/
- Imagefilms, Instructional videos and Tutorials https://w w w.youtube.com/user/w ylerag
- Manuals und Compendium
 http://w w w .w ylerag.com/en/support/documentation/manuals/
- Representatives WYLER AG/ Product Training http://w w w.w ylerag.com/en/contact/representatives/

INDEX

Key word	Chapter	Page
A		
ABSOLUTE MEASUREMENT / RELATIVE MEASUREMENT	3.5	22
ADJUSTMENT OF FILTER TYPES / FILTER	A11	47
ADJUSTMENT OF THE DISPLAY / DISPLAY	A5	41
ADJUSTMENT OF THE MEASURING UNIT / UNIT	A9	45
APPENDICES	А	37
В		
BACKGROUND COLOUR	2.2.3	15
BATTERIES	1.2.1	7
BRIGHTNESS	2.2.4	16
С		
CONFORMITY DECLARATIONS AND APPROVALS	E	63
D		
DESCRIPTION OF THE BLUELEVEL-2D	1.1	7
DIRECTIVE ON WASTE ELECTRICAL & ELECTRONIC EQUIPMENT (WEEE)	D4	63
DISPLAY	2.2	13
DISPLAY SETTINGS	4.2	29
DISPLAY SETTINGS	B2	51
DISPLAY THE FIRMWARE-VERSION / VERSION FIRMWARE	B9	58
DISPLAY TYPES	2.2.2	14
E		
Error Messages	С	62
F		
FACTORY RESET	4.11	35
FLOAT CHARTS GENERAL	А	37
FLOAT CHARTS OPTIONS	В	50
FUNCTION CHECK	4.12	36
FUNCTION CHECK / DEVICE CHECK	B11	60
FUNCTION CHECK / DEVICE CHECK	B12	61
FUNCTION HOLD	3.3	21
FUNCTIONS ON/OFF	4.5	32
G		
General	D1	62
GRAVITATION	4.8	33
GROUPING IN THE WIRELESS MODE / JOIN	3.7.2	26
GROUPING OF INSTRUMENTS TO A MEASURING GROUP IN THE WIRELESS MODE	3.7	26
GROUPING OF INSTRUMENTS WITH WIRELESS TRANSMISSION / JOIN	A12	48
GROUPING VIA CABLE CONNECTION / JOIN	3.7.1	26
Н		
HIDE DISABLED FUNCTIONS ON/OFF	4.6	32
HOW TO SWITCH THE INSTRUMENT ON AND OFF	2.1.2	11
l		
INTRODUCTION	1	7
Κ		
KEY HOLD, FREEZING OF A MEASURING VALUE / HOLD	A3	39
KEY REL.ZERO	A2	38
KEYS / FUNCTIONS / SHORT DESCRIPTIONS OF EACH SINGLE KEY	2.1.3	11
		10
LEAVING A GROUP OF INSTRUMETNS / LEAVE	A13	49
LOGARITHMIC SCALE UN/OFF / LOGSCALE UN/OFF	B3	52
	4.3	30
M		
		62
	A6	42
INTEASURING ABSOLUTE CONSIDERING THE ZERO OFFSET / MODE ABSOLUTE	A/	43

MEASURING RELATIVE / MODE REL ZERO A8 44 MEASURING WITH LIMITS 0 A4 40 OPERATION SHORT DESCRIPTION 0 A4 40 OPERATION SHORT DESCRIPTION 2.1 10 OPTODE-QUERY FOR ACCESS TO THE OPTIONS 4 28 OVERVIEW KEYBOARD AND DISPLAY B1 50 POSSBEE CONFIGURATIONS 1.2 8 PIN-CODE-QUERY FOR ACCESS TO THE OPTIONS B1 50 POSSBEE CONFIGURATIONS 1.2 7 PROGRAMMABLE KEYS R 1.2 7 PROGRAMMABLE KEYS R 1.2 7 PROGRAMMABLE KEYS R 1.2 7 RODIO ON/OFF 4.7 33 52 23 RELATIVE MEASUREMENT / REL ZERO ALIBRATION OPTION) 4.10 34 RESET TO FACTORY SETTINGS / FACTORY RESET B10 59 5 SCALING OF THE DISPLAY 2.2.1 13 31.1 18 SELECTION OF THE ENTIGENT MEASUREMENT) 3.1.1 18 57 SET MESOLUTE ZERO (WITH A REVERSAL MEASUREMENT) 3.1.1 18 21 20 SET MESOLUTE ZERO (WITH A REVERSAL MEASUREMENT) 3.1.1 18 32.1 20 STANDARD-UNITS 3.2.1 </th <th>ZERO</th> <th></th> <th></th>	ZERO		
MEASURING WITH LIMITS / LIMITS 3.6 24 MENU SELECTION 0 OPERATING INSTRUCTIONS BLUELEVEL-2D 3 OPERATION / SHORT DESCRIPTION 2.1 OPTIONS 4 OVERVIEW KEYBOARD AND DISPLAY 2.1.1 PIN-CODE-QUERY FOR ACCESS TO THE OPTIONS 1.2.2 POSSIBLE CONFIGURATIONS 1.2.2 PREPARATION AND START-UP 1.2.7 PROGRAMMABLE KEYS 'REL ZERO' AND 'ZERO/SELECT' / PROGRAMMABLE 4.4 READIO ON/OFF 3.5.2 Rabio ON/OFF 3.5.2 Rabio ON/OFF 3.5.2 SCALING OF THE DISPLAY 3.6.1 SCALING OF THE DISPLAY 3.1.1 SCALING OF THE MEASURING UNIT / UNIT 3.2.2 SELECTION OF THE MEASURING UNIT / UNIT 3.2.2 SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT) 3.1.1 STANDARD-UNITS 3.2.2 STANDARD-UNITS 3.2.1	MEASURING RELATIVE / MODE REL ZERO	A8	44
Intervent of the DisplayOA440OPERATION SHOULE VEL-2D338OPERATION SHOULE VEL-2D318OPERATION SHOULE VEL-2D318OPERATION SHOULE VEL-2D318OVERVIEW KEYBOARD AND DISPLAYP2.110PIN-CODE-GUERY FOR ACCESS TO THE OPTIONSPOSSIBLE CONFIGURATIONS1.2.28PREPARATION AND START-UP1.277PROGRAMMABLE KEYSR1.27PROGRAMMABLE KEYSR4.431PROGRAMMABLE KEYSR4.733Reading ON/OFFR4.733Rester Our Calubration (NULY POSSIBLE WITH OURCE CALIBRATION OPTION)8.1034RESET OUR CALIBRATION (NULY POSSIBLE WITH OURCE CALIBRATION OPTION)8.1118SET RASOLUTE ZERO (WITH A REVERSAL MEASUREMENT)3.1.118Set Our Coll REPARS6.635Set Our Coll REPARS.22.07Short DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS2.317Short DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS3.2.120Stanabod UNTS3.2.1202.2Stanabod UNTS3.2.120Stanabod UNTS3.2.120Stanabod UNTS3.2.120Stanabod UNTS3.2.120Stanabod UNTS3.2.120Stanabod UNTS3.2.120Stanabod UNTS3.2.120Stanabod UNTS5.554Switch The LOWERDSA	MEASURING WITH LIMITS / LIMITS	3.6	24
O O O OPERATING INSTRUCTIONS BLUELEVEL-2D 3 OPERATION / SHORT DESCRIPTION 2.1 OPERATION / SHORT DESCRIPTION P PIN-CODE-QUERY FOR ACCESS TO THE OPTIONS B1 POSSIBLE CONFIGURATIONS B1 POSSIBLE CONFIGURATIONS B1 PREPARATION AND START-UP 1.2 PROGRAMMABLE KEYS R RADIO ON/OFF R RADIO ON/OFF R RELATIVE MEASUREMENT / REL ZERO 3.5.2 RESET TO FACTORY SETTINGS / FACTORY RESET B10 SCALING OF THE DISPLAY S SCALING OF THE DISPLAY 2.2.1 SET PIN-CODE S SET PIN-CODE F SET PIN-CODE F SET PIN-CODE S STABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT) 3.1.1 SET PIN-CODE S SET PIN-CODE F STABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT) 3.1.1 STABLE AND HANDLING OF THE BATTERIES D3 STANDARD-UNITS 3.2.1 STARTING 2 STARDARG / CARE AND HANDLING OF TH	MENU SELECTION	Δ4	40
OPERATING INSTRUCTIONS BLUELEVEL-2D318OPERATION/SHORT DESCRIPTION2.110OPTIONS428OVERVIEW KEYBOARD AND DISPLAY2.1.110PIN-CODE-QUERY FOR ACCESS TO THE OPTIONSB150POSSIBLE CONFIGURATIONS1.2.28REPRARATION AND START-UP1.27PROGRAMMABLE KEYSR1.4ROGRAMMABLE KEYSR4.4RADIO ON/OFF83.5.2RESET TO FACTORY SETTINGS / FACTORY REST3.5.2SCALING OF THE DISPLAYS2.2.1SCALING OF THE DISPLAYS2.2.1SELECTION OF THE RUNDER DIFFERENT MEASURING CONDITIONS / FILTER3.4.1SELECTION OF THE REVENT WEASUREMENT)3.1.118SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)3.1.118SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)3.1.118SET PIN-CODE3.1.1104SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)3.1.118SET PIN-CODE3.1.1104START THE INSTRUMENT / ON/OFF3.2.210START THE INSTRUMENT / ON/OFF3.2.210START THE INSTRUMENT / ON/OFF554SWITCH THE COME ONS ON OR OFF / RADIO ON/OFF85SWITCH THE UNDER DUPLATERIES210SUTTAT THE INSTRUMENT / ON/OFF8554SWITCH THE LIDING OF DISABLED FUNCTIONS ON OR OFF / RADIO ON/OFF8554SWITCH THE LIDING OF DISABLED FUNCTIONS ON OR OFF / RADIO ON/OFF8554 <td>0</td> <td></td> <td></td>	0		
OPERATION/SHORT DESCRIPTION 0 10 OPERATION/SHORT DESCRIPTION 2.1 10 OPERATION/SHORT DESCRIPTION 4 28 OVERVIEW KEYBOARD AND DISPLAY 2.1.1 10 PIN-CODE-QUERY FOR ACCESS TO THE OPTIONS B1 50 POSSIBLE CONFIGURATIONS 1.2.2 8 PREPARATION AND START-UP 1.2.2 7 PROGRAMMABLE KEYS 4.4 31 PROGRAMMABLE KEYS R 4.7 33 RELATIVE MEASUREMENT / REL ZERO' AND "ZERO/SELECT" / PROGRAMMABLE 84 53 Keys R 7 33 Relative MEASUREMENT / REL ZERO 3.5.2 23 Reset QUICK CALIBRATION (ONLY POSSIBLE WITH QUICK CALIBRATION OPTION) 4.10 34 RESET QUICK CALIBRATION (IONLY POSSIBLE WITH QUICK CALIBRATION OPTION) 4.10 34 Seclection of THE DISPLAY 2.2.1 13 Selection of THE DISPLAY 2.2.1 13 Selection of THE DISPLAY 2.2.1 18 Selection of THE MEASURING UNIT / UNIT 3.2 20 Ser ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT) 3.1.1 18 Set ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT) 3.1.1 18 Short DESCRIPTION OF THE BILTER INDIVIDUAL DISPLAY AREAS 3.7<		3	18
OF DEVENTION OF THE NOTION DESCRIPTION OF TIONS OVERWIEW KEYBOARD AND DISPLAY P PN-COODE-QUERY FOR ACCESS TO THE OPTIONS POSSIBLE CONFIGURATIONS PREPARATION AND START-UP P PROGRAMMABLE KEYS R RADIO ON/OFF R RADIO ON/OFF R RADIO ON/OFF R RADIO ON/OFF R RADIO ON/OFF R RADIO ON/OFF R RADIO ON/OFF S SCALING OF THE DISPLAY S SCALING OF THE PLITER UNDER DIFFERENT MEASURING CONDITIONS / FILTER S SCALING OF THE PLITER UNDER DIFFERENT MEASURING CONDITIONS / FILTER S SCALING OF THE PLITER UNDER DIFFERENT MEASURING CONDITIONS / FILTER S SCALING OF THE RUSPLAY SET AUSOLUTE ZERO (WTH A REVERSAL MEASUREMENT) SET ABSOLUTE ZERO (WTH A REVERSAL MEASUREMENT) S START THE INSTUMENT / ON/OFF S START THE INSTUMENT / ON/OFF S START THE INSTUMENT / ON/OFF T EACH-IN OF THE INDIVIDUAL DISPLAY AREAS S STANDARD-UNITS START THE INSTUMENT / ON/OFF S START THE INSTUMENT / ON/OFF T EACH-IN OF THE INDIVIDUAL DISPLAY AREAS S STANDARD-UNITS START THE INSTUMENT / ON/OFF S START THE INSTUMENT / ON/OFF S START THE INSTUMENT / ON/OFF S START THE INSTUMENT / ON/OFF S S SUTCH THE WIRELESS TRANSMISSION ON OR OFF / GANUTATION COMPENSATION B S S S S S S S S S S S S S		21	10
OVERVIEW KEYBOARD AND DISPLAY P OVERVIEW KEYBOARD AND DISPLAY P PIN-CODE-QUERY FOR ACCESS TO THE OPTIONS B1 POSSIBLE CONFIGURATIONS 1.2.2 PROGRAMMABLE KEYS 1.2.2 PROGRAMMABLE KEYS 1.2.2 PROGRAMMABLE KEYS 1.2.2 R 1.2.2 RADIO ON/OFF 4.4 RADIO ON/OFF 4.7 RELATIVE MEASUREMENT / REL ZERO' AND "ZERO/SELECT" / PROGRAMMABLE KEYS R RELATIVE MEASUREMENT / REL ZERO 3.5.2 RELATIVE MEASUREMENT / REL ZERO 3.5.2 SCALING OF THE DISPLAY 3.5.2 SCALING OF THE DISPLAY 8 SELECTION OF THE INTER UNDER DIFFERENT MEASURING CONDITIONS / FILTER 3.4 SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT) 3.1.1 SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT) 3.1.1 SETTING OF LIMITS / LIMITS 3.1.1 STANDARO-UNITS 3.2.1 STANDARO-UNITS 3.2.1 STANDARO-UNITS 3.2.2 STANDARO-UNITS 3.2.1 STANDARO-UNITS 3.2.1 STANDARO-UNITS 3.2.1 STANDARO-UNITS 3.2.1 STANDARO-UNITS 3.2.1 STANDARO-UNITS 3.2.2		2.1	28
OVERVIEW RETEXTORY OF ACCESS TO THE OPTIONS P PIN-CODE-QUERY FOR ACCESS TO THE OPTIONS B1 50 POSSIBLE CONFIGURATIONS 1.2.2 8 PREPARATION AND START-UP 1.2.2 8 PROGRAMMABLE KEYS 4.4 31 PROGRAMMABLE KEYS R 4.4 31 Rest QUICK CAUBRATION (ONLY POSSIBLE WITH QUICK CALIBRATION OPTION) 4.10 34 RESET QUICK CAUBRATION (ONLY POSSIBLE WITH QUICK CALIBRATION OPTION) 4.10 34 Selection OF THE ENSING UNT / UNIT 3.2 20 5 Scalung of the Englex UNT A REVERSAL MEASUREMENT) 3.1.1 18 4.1 29 Set ABSOLUTE ZERO (WITH A REVERSAL ME		+ 211	10
PIN-CODE-QUERY FOR ACCESS TO THE OPTIONSB150POSSIBLE CONFIGURATIONS1.2.28PREPARATION AND START-UP1.27PROGRAMMABLE KEYS4.431PROGRAMMABLE KEYS "REL ZERO" AND "ZERO/SELECT" / PROGRAMMABLEB453Rest4.431PROGRAMMABLE KEYS "REL ZERO" AND "ZERO/SELECT" / PROGRAMMABLEB453Rest TO FACTORY SET INGS / FACTORY RESET3.5.223Reset TO FACTORY SETTINGS / FACTORY RESETB1059S CALING OF THE DISPLAY2.2.113Selection of THE DISPLAY2.2.113Selection of THE MERSURING UNIT / UNIT3.220SER ABSOLUTE ZERO (WITH A REVERSAL MEASURING CONDITIONS / FILTERSSet ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)S1.1.1SET PIN-CODE4.129SETTING OF LIMITS / LIMITSA1046SHORT DESCRIPTION OF THE INSTRUMENT / ON/OFF3.2.120STANDARO-UNITS3.2.1203STANDARO-UNITS3.2.120STANDARO-UNITS3.2.120STANDARO-UNITS3.2.120STANDARO-UNITS3.2.120STANDARO-UNITS3.2.120STANDARO-UNITS3.2.120STANDARO-UNITS3.2.120STANDARO-UNITS3.2.120SUTCH THE UNCELESS TRANSMISSION ON OR OFF / GRAVITATION COMPENSATIONB8SUTCH THE WIRELESS TRANSMISSION ON OR OFF / GRAVITATION COMPENSATIONB6SUTCHING FUNCTIONS ON OR OFF / FUNCTIONS ON	P	2.1.1	10
In CODUC DECEMPTION OF THE DATION OF OF F / RADIO ON/OFF 0 0 STANDARO VARE 2 20 STANDARO VARE 2.2.1 13 STANDARO VARIANTIAL DATION OF THE DATION ON OF F / RADIO ON/OFF 0 SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFF 3.2.1 20 SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFF 0 0 SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFF 0 0 SWITCH THE WIRELESS TRANSMISSION ON OR OFF / HADE DAABLED 0 0 TEACH-IN OF THE DATION ON OFF / GRAVITATION COMPENSATI	PIN-CODE-OUERY FOR ACCESS TO THE OPTIONS	R1	50
OUDDEL OWN MADEThe State of the set of th		122	8
International processing and the processing of the pr		1.2.2	7
Introdivationalized Kerys TREL ZERO* AND "ZERO/SELECT" / PROGRAMMABLE F.4 53 Kerys R 53 Kerys R 53 Relative MEASUREMENT / REL ZERO 3.5.2 23 Reset Quick Calibration (ONLY POSSIBLE with Quick calibration option) 4.10 34 Reset Quick Calibration (ONLY POSSIBLE with Quick calibration option) 8 50 Scaling of the Display 2.2.1 13 Selection of the measuring unit / UNIT 3.2 20 Set absolute ZERO (with a Reversal Measurement) 3.1.1 18 Set absolute ZERO (with a Reversal Measurement) 3.1.1 18 Set of Limits / LIMITS 4.1 29 Short Description of the INDIVIDUAL DISPLAY AREAS 2.3 17 Spare Parts / Accessories D3 62 Stanbaro-UNITS 3.2.1 20 Starting 2 10 Starting 2 10 Starting 2 10 Starting File Ransingsion on or of F / Gravitation Compensation 85 Switch the WireLess Transmission on or of F / Rabio ON/OFF 85 Switching Functions on or of F / Functions ON OFF / Hable Disabled 86 Starting File Ransingsion on or of F / Functions ON OFF / Hable Disabled 65 <t< td=""><td></td><td>1.2</td><td>31</td></t<>		1.2	31
RCONVAMINABLE NETS RELIZENCE AND ZETRO/SELECT / FROGRAMMABLE D4 3.3 Keys R Radio ON/OFF 4.7 33 Relative Measurement / REL ZERO 3.5.2 23 Reser Quick Calibration (only possible with quick calibration option) 4.10 34 Reset To Factory Settings / Factory Reset B10 59 S S	DROCRAMMADIE KEVS "DEL ZEDO" AND "ZEDO/SELECT" / DROCRAMMADIE	 R/	53
RRRabio ON/OFF4.733Reset TQUICK CALIBRATION (ONLY POSSIBLE WITH QUICK CALIBRATION OPTION)4.1034Reset TO FACTORY SETTINGS / FACTORY RESETB1059SS55Scaling OF THE DISPLAY2.2.113SELECTION OF THE FILTER UNDER DIFFERENT MEASURING CONDITIONS / FILTER3.422SELECTION OF THE MEASURING UNIT / UNIT3.220SERVICE AND REPAIRF63SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)3.1.118SET PIN-CODE4.129SETTING OF LIMITS / LIMITSA1046SHORT DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS2.317SPARE PARTS / ACCESSORIESD362STANDARD-UNITS3.2.120START THE INSTRUMENT / ON/OFFA137START THE INSTRUMENT / ON/OFFA137STORAGE/ CARE AND HANDLING OF THE BATTERIESD262SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATIONB857SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFFB554SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON OR OFF / Hide DISABLEDB655FUNCTIONS ON/OFFT3.2.220VV3.2.220VV3.2.220VV3.2.23.2.2VV3.2.23.2.1SUBLESS TRANSMISSION ON OR OFF / Hide DISABLEDB655SUTCHING OF DISABLED FUNCTIONS ON OR OFF / Hide DISABLED <td>KEYS</td> <td>04</td> <td>55</td>	KEYS	04	55
Rabio ON/OFF4.733ReLATIVE MEASUREMENT / REL ZERO3.5.223RESET QUICK CALIBRATION (ONLY POSSIBLE WITH QUICK CALIBRATION OPTION)4.1034RESET QUICK CALIBRATION (ONLY POSSIBLE WITH QUICK CALIBRATION OPTION)4.1034RESET QUICK CALIBRATION (ONLY POSSIBLE WITH QUICK CALIBRATION OPTION)4.1034Reset To FACTORY SETTINGS / FACTORY RESETB1059SSSSScaling of The DISPLAY2.2.113Selection of The Filter UNDER DIFFERENT MEASURING CONDITIONS / FILTER3.422Service AND REPARF63Set ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)3.1.118Set PIN-CODE4.129SetTING OF LIMITS / LIMITSA1046Short DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS2.317SPARE PARTS / ACCESSORIESD362STANDARD-UNITS3.2.120START THE INSTRUMENT / ON/OFFA137START THE INSTRUMENT / ON/OFFD262SWITCH THE WIRELESS TRANSMISSION ON OR OFF / GRAVITATION COMPENSATIONB857SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFFB554SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFFB554SWITCH THE WIRELESS TRANSMISSION ON OR OFF / HIDE DISABLEDB655UNITS WITH RELATIVE BASE LENGTH3.2.200VVERSION FIRMWARE200ZZ0211SUBLEMENT / ON OR OFF	R		
Notion ContornNotion ContornNotion ContornReLative Measurement / REL ZERO3.5.223Reset Quick Calibration (only possible with quick calibration option)4.1034Reset To Factory Settings / Factory ResetB1059SS55Scaling of The Display2.2.113Selection of The Filter under different measuring conditions / FILTER3.422Service and ReparF63Set PIN-Code4.129Set PIN-Code4.129Set Discription of The Individual display areas2.317Spare Parts / AccessoriesD362Starting3.2.120Starting3.2.120Starting210Storage/ CARE and handling of the batteriesD262Switch ing Tunctions on or off / Ravitation CompensationB857Switch ing Tunctions on or off / Functions on or off / Hide DisabledB655Functions ON/OFFS5454Switching The Hiding of Disabled Functions on or off / Hide DisabledB655Functions ON/OFF543.2.220VVersion Firmware4.934ZEPO Setting / Appoint Report Zepo2.118		47	33
RESET QUICK CALIBRATION (ONLY POSSIBLE WITH QUICK CALIBRATION OPTION)4.1034RESET QUICK CALIBRATION (ONLY POSSIBLE WITH QUICK CALIBRATION OPTION)8.1059SSSScaling of The Display2.2.113Selection of The Filter under different measuring conditions / FILTER3.422Selection of The Measuring UNIT / UNIT3.220Service and ReparF63Set absolute ZERO (with a reversal measurement)3.1.118Set PIN-Code4.129Setting of Limits / LIMITSA1046Short Description of The Individual display areas2.317Spare Parts / AccessoriesD362Standard-units3.2.120Standard-units3.2.120Standard-units3.2.120Stant The INSTRUMENT / ON/OFFA137Stant The INSTRUMENT / ON/OFFA137Switching Functions on or off / Gravitation CompensationB857Switching Functions on or off / Gravitation CompensationB655Sutching The Hiding of Disabled Functions ON/OFFB554Switching The Hiding of Disabled Functions on or off / Hide DisabledB655Functions ON/OFFT3.2.220UUUUUUUU00Version Firmware22021Stant Adding The Base Length220Version Firmware234234<	RELATIVE MEASUREMENT / REL ZERO	352	23
NEEL CONCOUND AND IN CONCENT POSSIBLE WITH CONCOUND AND INCOMPANION OF THEM INCOMPANION ON OF F/GRAVITATION COMPENSATION B10 59 START THE INSTRUMENT / ON/OFF A11 31.1 118 START THE INSTRUMENT / ON/OFF A11 37 START THE INSTRUMENT / ON OR OFF / GRAVITATION COMPENSATION B8 57 SWITCH THE VIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFF B5 54 SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON OR OFF / HIDE DISABLED B6 55 FUNCTIONS ON/OFF B5 54 WITCH RELATIVE BASE LENGTH </td <td></td> <td><i>1</i> 10</td> <td>20</td>		<i>1</i> 10	20
S S SCALING OF THE DISPLAY 2.2.1 SELECTION OF THE FILTER UNDER DIFFERENT MEASURING CONDITIONS / FILTER 3.4 22 SELECTION OF THE MEASURING UNIT / UNIT 3.2 20 SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT) 3.1.1 18 SET PIN-CODE 4.1 29 SETTING OF LIMITS / LIMITS A10 46 SHORT DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS 2.3 17 SPARE PARTS / ACCESSORIES D3 62 STANDARD-UNITS 3.2.1 20 START THE INSTRUMENT / ON/OFF A1 37 STORAGE/ CARE AND HANDLING OF THE BATTERIES D2 62 SWITCH THE WIRELESS TRANSMISSION ON OR OFF / GRAVITATION COMPENSATION B8 57 SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFF B7 56 SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON OR OFF / HIDE DISABLED B6 55 FUNCTIONS ON/OFF T 54 54 SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF / HIDE DISABLED B6 55 SUNTCH THE WIRE LEINER 3.2.2 20 62 V V V <	RESET TO EACTORY SETTINGS / FACTORY RESET	R10	59
Scaling of the Display2.2.113Selection of the Filter under different measuring conditions / FILTER3.422Service and Repair3.220Service and RepairF63Set absolute ZERO (with a reversal measurement)3.1.118Set PIN-Code4.129Setting of Limits / LIMITSA1046Short Description of the individual display areas2.317Spare Parts / AccessoriesD362Stant the instrument / ON/OFFA137Start The instrument / ON/OFFA137Storage / CARE and handling of the batteriesD262Switch the Wireless Transmission on or off / Gravittation CompensationB857Switch the Wireless Transmission on or off / Radio ON/OFFB554Switching functions on or off / Functions on or off / Hide disabledB655Functions ON/OFFT3.827UU4.934ZERO Science Z210VVersion Firmware4.934ZERO Science Z214	S	ыю	
Selection of the filter under different measuring conditions / FiltER3.422Selection of the measuring unit / UNIT3.220Service and ReparF63Set absolute ZERO (with a reversal measurement)3.1.118Set PIN-Cobe4.129Setting of Limits / LIMITSA1046Short Description of the individual display areas2.317Spare Parts / AccessoriesD362Stanting3.2.120Starting3.2.120Starting3.2.120Starting3.2.120Starting210Storage/ CARE and handling of the batteriesD262Switch the Compensation of gravity on or off / Gravitation CompensationB857Switching Functions on or off / Functions on or off / Rabio ON/OFFB554Switching the Hiding of Disabled Functions on or off / Hide disabledB655Functions ON/OFFT3.2.220UU3.2.220VVersion Firmware4.934ZZ22Start of the IR-trigger (Zapper)3.827UU222Start of the See Length3.2.220VVersion Firmware4.934ZZ22Start of the See Length233UStart of the See Length3.2.233Start of the See Length23	SCALING OF THE DISPLAY	2.2.1	13
SELECTION OF THE MEASURING UNIT / UNIT3.220SERVICE AND REPAIRF63SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)3.1.118SET PIN-CODE4.129SETTING OF LIMITS / LIMITSA1046Short DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS2.317SPARE PARTS / ACCESSORIESD362STANDARD-UNITS3.2.120STARTING3.2.120STORAGE/ CARE AND HANDLING OF THE BATTERIESD262SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATIONB857SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFFB554SWITCH ING FUNCTIONS ON OR OFF / FUNCTIONS ON OR OFF / HIDE DISABLEDB655FUNCTIONS ON OR OFF / FUNCTIONS ON OR OFF / HIDE DISABLEDB655FUNCTIONS ON/OFF3.8270UU000UU0000VVERSION FIRMWARE200ZEEDO SECTING (ARED UTT ZEDO2.1180	SELECTION OF THE FILTER UNDER DIFFERENT MEASURING CONDITIONS / FILTER	3.4	22
SERVICE AND REPAIRF63SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)3.1.118SET PIN-CODE4.129SETTING OF LIMITS / LIMITSA1046SHORT DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS2.317SPARE PARTS / ACCESSORIESD362STANDARD-UNITS3.2.120START THE INSTRUMENT / ON/OFFA137START THE INSTRUMENT / ON/OFFA137STORAGE/ CARE AND HANDLING OF THE BATTERIESD262SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATIONB857SWITCH THE WRELESS TRANSMISSION ON OR OFF / RADIO ON/OFFB756SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON/OFFB554SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF / HIDE DISABLEDB655FUNCTIONS ON/OFFT3.2.220UUUUUVVERSION FIRMWARE4.934ZZ2114	SELECTION OF THE MEASURING UNIT / UNIT	3.2	20
SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)3.1.118SET PIN-CODE4.129SETTING OF LIMITS / LIMITSA1046SHORT DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS2.317SPARE PARTS / ACCESSORIESD362STANDARD-UNITS3.2.120START THE INSTRUMENT / ON/OFFA137START TING210STORAGE/ CARE AND HANDLING OF THE BATTERIESD262SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATIONB857SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFFB756SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON/OFFB554SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF / HIDE DISABLEDB655FUNCTIONS ON/OFFT3.2.220VVERSION FIRMWARE4.934ZZ1448	SERVICE AND REPAIR	F	63
SET PIN-CODE4.129SETTING OF LIMITS / LIMITSA1046SHORT DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS2.317SPARE PARTS / ACCESSORIESD362STANDARD-UNITS3.2.120START THE INSTRUMENT / ON/OFFA137START THE INSTRUMENT / ON/OFFA137STARTING210STORAGE/ CARE AND HANDLING OF THE BATTERIESD262SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATIONB857SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFFB756SWITCH ING FUNCTIONS ON OR OFF / FUNCTIONS ON OR OFF / HIDE DISABLEDB655FUNCTIONS ON/OFFTUUUUVVERSION FIRMWARE4.934ZZ18-	SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)	3.1.1	18
SETTING OF LIMITS / LIMITSA1046SHORT DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS2.317SPARE PARTS / ACCESSORIESD362STANDARD-UNITS3.2.120START THE INSTRUMENT / ON/OFFA137START THE INSTRUMENT / ON/OFFA137STORAGE/ CARE AND HANDLING OF THE BATTERIESD262SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATIONB857SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFFB756SWITCH ING FUNCTIONS ON OR OFF / FUNCTIONS ON OR OFF / HIDE DISABLEDB655FUNCTIONS ON/OFFTT1TEACH-IN of the IR-trigger (Zapper)3.827UU11UU11V134Z21Z211	SET PIN-CODE	4.1	29
SHORT DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS2.317SPARE PARTS / ACCESSORIESD362STANDARD-UNITS3.2.120START THE INSTRUMENT / ON/OFFA137START THE INSTRUMENT / ON/OFF210STORAGE / CARE AND HANDLING OF THE BATTERIESD262SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATIONB857SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFFB756SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON/OFFB554SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF / HIDE DISABLEDB655FUNCTIONS ON/OFFT	SETTING OF LIMITS / LIMITS	A10	46
SPARE PARTS / ACCESSORIESD362STANDARD-UNITS3.2.120START THE INSTRUMENT / ON/OFFA137START THE INSTRUMENT / ON/OFF210STORAGE / CARE AND HANDLING OF THE BATTERIESD262SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATIONB857SWITCH THE WIRELESS T RANSMISSION ON OR OFF / RADIO ON/OFFB756SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON/OFFB554SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF / HIDE DISABLEDB655FUNCTIONS ON/OFFT	SHORT DESCRIPTION OF THE INDIVIDUAL DISPLAY AREAS	2.3	17
STANDARD-UNITS3.2.120START THE INSTRUMENT / ON/OFFA137STARTING210STORAGE/ CARE AND HANDLING OF THE BATTERIESD262SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATIONB857SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFFB756SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON/OFFB554SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF / HIDE DISABLEDB655FUNCTIONS ON/OFFT3.8.827UUUUUUNITS WITH RELATIVE BASE LENGTHX.2.220VVERSION FIRMWARE4.934ZZ1834	Spare Parts / Accessories	D3	62
START THE INSTRUMENT / ON/OFF A1 37 STARTING 2 10 STORAGE/ CARE AND HANDLING OF THE BATTERIES D2 62 SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATION B8 57 SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFF B7 56 SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON/OFF B5 54 SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF / HIDE DISABLED B6 55 FUNCTIONS ON/OFF T T TEACH-IN of the IR-trigger (Zapper) 3.8 27 U U U U UNITS WITH RELATIVE BASE LENGTH 3.2.2 20 V V 4.9 34 Z Z 18	STANDARD-UNITS	3.2.1	20
STARTING 2 10 STORAGE/ CARE AND HANDLING OF THE BATTERIES D2 62 Switch THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATION B8 57 Switch THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFF B7 56 Switching Functions on or off / Functions ON/OFF B5 54 Switching the Hiding of Disabled Functions on or off / Hide Disabled B6 55 Functions ON/OFF 3.8 27 U U U U UNITS with Relative BASE LENGTH 3.2.2 20 V Version Firmware 4.9 34 Z 2 10	START THE INSTRUMENT / ON/OFF	A1	37
STORAGE/ CARE AND HANDLING OF THE BATTERIES D2 62 SWITCH THE COMPENSATION OF GRAVITY ON OR OFF / GRAVITATION COMPENSATION B8 57 SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFF B7 56 SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON/OFF B5 54 SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF / HIDE DISABLED B6 55 FUNCTIONS ON/OFF T 3.8 27 U U U U U UNITS WITH RELATIVE BASE LENGTH 3.2.2 20 V V 4.9 34 Z Z 18 18	STARTING	2	10
Switch the compensation of gravity on or off / Gravitation Compensation B8 57 Switch the Wireless Transmission on or off / Radio ON/OFF B7 56 Switching Functions on or off / Functions ON/OFF B5 54 Switching the Hiding of Disabled Functions on or off / Hide Disabled B6 55 Functions ON/OFF T T TEACH-IN of the IR-trigger (Zapper) 3.8 27 U U U U UNITS WITH RELATIVE BASE LENGTH 3.2.2 20 V Version Firmware 4.9 34 Z Z 24 18	STORAGE/ CARE AND HANDLING OF THE BATTERIES	D2	62
Switch the Wireless Transmission on or off / Radio ON/OFF B7 56 Switching Functions on or off / Functions ON/OFF B5 54 Switching the Hiding of disabled functions on or off / Hide disabled B6 55 Functions ON/OFF T	SWITCH THE COMPENSATION OF GRAVITY ON OF OFF / GRAVITATION COMPENSATION	B8	57
Switching Functions on or off / Functions ON/OFF Switching The Hidling of Disabled Functions on or off / Hide Disabled Functions ON/OFF T TEACH-IN of the IR-trigger (Zapper) U UNITS WITH RELATIVE BASE LENGTH V Version Firmware Z Z TERO SETTING (Apponiute ZERO 10 10 10 10 10 10 10 10 10 10	SWITCH THE WIRELESS TRANSMISSION ON OR OFF / RADIO ON/OFF	B7	56
SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF / HIDE DISABLED FUNCTIONS ON/OFF T TEACH-IN of the IR-trigger (Zapper) U UNITS WITH RELATIVE BASE LENGTH V VERSION FIRMWARE Z ZEPO SETTING (Apponunts ZEPO 10 10 10 10 10 10 10 10 10 10	SWITCHING FUNCTIONS ON OR OFF / FUNCTIONS ON/OFF	B5	54
FUNCTIONS ON/OFF T TEACH-IN of the IR-trigger (Zapper) U UNITS WITH RELATIVE BASE LENGTH V VERSION FIRMWARE Z Z EPO SETTING (Apportune ZEPO	SWITCHING THE HIDING OF DISABIED FUNCTIONS ON OF OFF / HIDE DISABIED	B6	55
TEACH-IN of the IR-trigger (Zapper) U UNITS WITH RELATIVE BASE LENGTH V VERSION FIRMWARE Z ZERO SETTING (ADSOLUTE ZERO	FUNCTIONS ON/OFF	20	00
TEACH-IN of the IR-trigger (Zapper) U UNITS WITH RELATIVE BASE LENGTH V VERSION FIRMWARE Z ZERO SETTING (ADSOLUTE ZERO	Т		
U UNITS WITH RELATIVE BASE LENGTH V VERSION FIRMWARE Z ZERO SETTING / Appoint ZERO 18	TEACH-IN of the IR-trigger (Zapper)	3.8	27
UNITS WITH RELATIVE BASE LENGTH V VERSION FIRMWARE Z ZERO SETTING (ARSOLUTE ZERO		0.0	
V VERSION FIRMWARE 4.9 34	UNITS WITH RELATIVE BASE LENGTH	3.2.2	20
VERSION FIRMWARE 4.9 34 Z		012.12	
Z Z 25 21 12		4 9	34
	7	- 1.0	
		3.1	18

1 INTRODUCTION

1.1 DESCRIPTION OF BLUELEVEL-2D

The BlueLEVEL-2D is a high precision and compact inclination measuring instrument for 2 axes. In spite of its small outer dimensions the instrument contains 2 inclination sensors one in X- and one in Y- direction together with a full graphical and color 2D-display.

Thanks to its precision and its size the BlueLEVEL-2D is perfectly suited for the alignment of machines and machine parts. It can be used as stand-alone unit but can also be used in combination with a WYLER measuring software.

The Blue Level-2D is designed as a high-precision measuring instrument

The following parameters (among others) can be set and changed at the BlueLEVEL-2D:

- Units
- Display of measuring range
- Type of display
- Filter settings



It is possible to send the measured data via an RS232 port to a PC/laptop and therewith to the WYLER software LEVELSOFT PRO, MT-SOFT and LabEXCEL software.

The BlueLEVEL-2D contains two sensors based on the analog measuring principle. The analog measuring principle is optimized for the measurement of straightness, flatness, etc. with handheld instruments because this measurement principle provides a stable value very quickly, which is very important for precise measurements and an efficient measurement process. Furthermore it is very insensitive to low-frequency interference, as can sometimes occur in machine tools.

1.2 PREPARATION AND START-UP

PRIOR TO STARTING

Please read this manual prior to working with the BlueLEVEL-2D. You will get an overview on all the functions and possibilities of this instrument. At the same time you get familiar with the handling of the instrument and wrong handling and specifically the unintentional erasing of the calibration data can be avoided.

1.2.1 BATTERIES

The batteries are not inserted in the instrument during shipment. It is strongly recommended to remove the batteries during transport.

The battery voltage is shown in the display e.g. 27 (2.7 Volt)

Lowest possible battery voltage is **1.7 Volt**. If the voltage drops below this value a blinking battery

symbol is shown: The batteries should then be exchanged rather soon.

2 pieces 1.5V, Size "C" ALKALINE





As an end user you are forced by law to return all used batteries and accumulators, a disposal through household waste is prohibited.

Batteries/accumulators containing contaminants are marked with the symbol shown, which clearly indicates the prohibition of disposal through household waste.

You can dispose of your used batteries/accumulators free of charge at the collecting points of your community, our distribution partners or at each location selling batteries/accumulators. You thus fulfil your legal obligation and contribute to the protection of the environment.

1.2.2 POSSIBLE CONFIGURATIONS



Stand-alone instrument



BlueLEVEL-2D connected via an USB cable to a PC/Laptop



A BlueLEVEL-2D connected to a laptop with the RS232 cable. The instrument is powered from an external power supply



Two BlueLEVEL-2D connected to a laptop with USB cables allowing simultaneous differential measurement in 2 directions. The instruments are powered from the USB-ports.



A BlueLEVEL-2D connected via Bluetooth to a BlueTC and to a laptop.



Two BlueLEVEL-2D connected via Bluetooth to a BlueTC and to a laptop.



Two BlueLEVEL-2D connected via Bluetooth to a BlueMETER SIGMA and to a laptop.

Please check the respective manuals and data sheets for details on the other products shown above.

2 STARTING

2.1 **OPERATION/ SHORT DESCRIPTION**

2.1.1 OVERVIEW KEYBOARD AND DISPLAY



2.1.2 How to switch the instrument ON and OFF

The BlueLEVEL-2D features an automatic shut off. In normal mode the instrument is automatically switched off 60 minutes after the last key operation. This automatic shut OFF function can be deactivated with a special ON sequence or when using an external power supply

To switch ON

Keep the key ON/MODE pressed until the display and all LEDs are lit and release the key. The instrument will automatically shut off 60 minutes after the last key operation. If you keep the key ON/MODE pressed for **more than 10 seconds** the automatic OFF function is deactivated. This is indicated by blinking LEDs.

The instrument carries out a short function test and establishes connections to other instruments, if any had been available before switching off the instrument.

The instrument changes into measuring mode. The settings, which were used prior to switching the instrument off, are reloaded.

To switch OFF

Keep the key <u>ON/MODE</u> pressed until the display disappears (about 3 seconds). All settings are kept and will be reloaded again next time the instrument is switched on.

2.1.3 Keys / Functions / Short descriptions of each single key

	ON/MODE - Key
Function - 1 -	To switch the BlueLEVEL-2D ON. When for starting the key ONMODE is pressed, a grey picture will appear on the screen and all LEDs will be illuminated. After releasing the key the BlueLEVEL-2D is switching to the measuring mode. The current inclination is displayed in the mode and unit which was used before switching the instrument OFF. In case of an error the respective error message is shown in the display. The instrument will automatically shut of 60 minutes after the last key operation.
	If the key ON/MODE is pressed for more than 10 seconds the LEDs start blinking and the automatic OFF function is deactivated. Exception: If the BlueLEVEL-2D is powered from an external power supply, the automatic OFF function is deactivated and the instrument will remain ON.
Function - 2 -	To switch OFF, press the key <u>ON/MODE</u> more than 3 seconds, until the display disappears.
Function - 3 -	With the key <u>ON/MODE</u> you open the menu. Pressing the key repeatedly will move you through the menu which is indicated by the cursor moving down to the required function.

	ON/MODE - Key		
Function - 4 -	While setting a value with the key <u>ON/MODE</u> the default value can be recalled.		
ENTER			ENTER – key
Function - 1 -	The key ∠ entered	ENTER / Eis	s used to confirm a chosen function or to save a value
Function - 2 -	While in the function "REL ZERO" or "ABS ZERO" the measuring can be started or an ongoing measuring can be finished by pressing the key		
SEND/ESC/			SEND/ESC- key
Function - 1 -	The key <u>SEND/ESC</u> is used to send / transmit a measuring value to a PC or to a printer or similar output device through the RS485 port		
	Data format OUT port: [sss xxxxtt sn.nnnnn xxxxxtt sn.nnnnnn <cr>]</cr>		[sss xxxxxtt sn.nnnnn xxxxxtt sn.nnnnnn <cr>]</cr>
		SSS =	0 255 – sequence number
	e.g.	xxxxxtt = N2473Dx N2473Dy	Sensor Serial Number and Type BlueLEVEL-2D X-Axis BlueLEVEL-2D Y-Axis
		sn.nnnnnn =	 inclination in rad, e.g. +0.226349 +9.999999 -> Positive Overrange -9.9999999 -> Negative Overrange
	Example:	112 N2473I	Dx -0.021033 N2473Dy +0.002289
	Format of t	ransmission: asynchron, 7	7Bit, 2 Stopbits, no parity, 9600 Baud
Function - 2 -	Unfreeze of the "HOLD"- function to return to the measuring mode. At the same time the "frozen" value is sent to the RS 485 port to any connected device		
Function - 3 -	Escape fur	nction from the	e menu

ZERO/SELECT	ZERO/SELECT "+/-" - key
Function - 1 -	The key $\overline{ZERO/SELECT}$ 4 $\overline{4}$ is used to
	changing the scale in the display
	 increase / decrease the display range
	This function can, however, be disabled in the instrument settings.
Function - 2 -	The key $\sqrt{\text{ZERO/SELECT}}$ $rac{1}{2}$ is used to select possible adjustments, such as
	menu selection
	 modification of a number
	HOLD - key
Function - 1 -	The key HOLD serves for "freezing" a measuring value. The value is
	displayed until the BlueLEVEL-2D returns to the measuring mode by pressing
	the <u>SEND/ESC</u> key.
	,
Function - 2 -	In the functions "REL.ZERO" and "ABS.ZERO" the key HOLD + is used

REL ZERO - key

for reading in the actual measuring value again during the manual entering.

Function - 1 - The key <u>RELZERO</u> serves for setting the actual inclination as the relative Zero.

2.2 DISPLAY

The BlueLEVEL-2D features various graphic displays which can be scaled according to the requirements of the measuring task. Also the background colour and the brightness of the display can be adjusted.

2.2.1 SCALING OF THE DISPLAY

For an optimal use of the graphic display, you have various options for scaling.

With the linear scaling the display precision remains constant over the full range. With the keys $\sqrt{2ERO/SELECT}$ the resolution can be changed. Thus also the range being displayed will be changed.

With the logarithmic scaling the display precision around Zero is the highest and it is reduced continuously with higher inclination values. Around Zero the resolution corresponds to the unit selected.

In the adjustments of the instrument you can switch between linear and logarithmic scaling.

Using the key <u>ON/MODE</u> select the menu point [Options] and confirm with ENTER . Select now [Logscale] and confirm with ENTER

Switch the logarithmic scaling ON or OFF using the keys $\angle ZERO/SELECT / \bigcirc \bigcirc$. The display will show the requested state of the instrument. Confirm with the key $\angle ENTER / \blacksquare$.



The instrument will return to the measuring mode. If the logarithmic scaling is enabled, the symbol "LOG" will appear below the graph.

2.2.2 DISPLAY TYPES

The display type can be selected in the menu "display".

Using the key <u>ON/MODE</u> select the menu point [Display] and confirm this selection with <u>ENTER</u>.

Select the required display type using the keys \angle ZERO/SELECT \bigcirc and confirm your selection with the key \angle ENTER \bigcirc .



The following display types are available in the BlueLEVEL-2D:



2.2.3 BACKGROUND COLOUR

In the adjustments of the instrument the background colour can be selected. Depending on the brightness of the colour selected the colour of the fonts and the symbols will change between black and white.



With the keys $\sqrt{\text{ZERO/SELECT}} \Phi^{-1}$ select the display colour and
confirm the selection with the key ENTER .



2.2.4 BRIGHTNESS

Adjustment of the brightness of the display. Difference between battery operation and the use of an external power supply.

In the adjustments of the instrument the brightness of the display can be adjusted in order to adapt it to the environmental conditions and to optimise the battery life time. Thus two different values can be set for the battery operation and the operation with an external power supply

Using the key ONMODE on mode select the menu point [Options] and confirm with ENTER . Select now [Display Settings] and confirm with ENTER . Using the keys ZERO/SELECT & Select [Brightness] for the adjustment when using an external power supply and [Brightness Powersave] for the adjustment in battery operation. Confirm this selection with ENTER.

With the keys ZERO/SELECT • you can adjust the brightness required. The display will show the power consumption in a range from 10% to 100% of the maximum brightness. Only steps of 10% are possible. Confirm the adjustment with the key ENTER. With the key ON/MODE the default value of 50% will be recalled.





Main

In the main display the actual measuring value will be displayed. display Display of the A symbol indicates the direction of the inclination of the value direction of the displayed. inclination inclined to the right (positive inclination) declined to the right (negative inclination) The HOLD function is activated, i.e. the measuring value is on hold "freezed". Absolute measurement is activated. ABS Relative measurement is activated, i.e. the measuring value is REL the difference between the current and the reference plane, i.e. the relative base. Shows the selected displaying range. The displaying range displaying range can be adjusted using the keys $\overline{ZERO/SELECT}$ $\Phi \Phi$ provided 60° that this function is enabled in the options. scale division Angle between two tick marks. 5° Scale division Indicates that the logarithmic scale is in use. If this sign is LOG missing, the linear scale is in use. Shows the serial number of the instrument. Serial number • X-Axis: A+Serial number+x • Y-Axis: B+Serial number+Y Display of the current battery voltage (example 2.6 V). The lowest possible voltage is 1.7 Volt. After a further voltage drop **Battery voltage** a blinking battery symbol will appear. The batteries must then **2**6 be exchanged immediately. A plug symbol will appear when the instrument is powered by an external source. Display of the measuring unit in use. There are 10 basic units Measuring unit available, whereas for each setting various options can be selected.

3 OPERATING INSTRUCTIONS BLUELEVEL-2D

The BlueLEVEL-2D offers a wide range of functions and adjustment possibilities. The list of functions appears when the key ONMODE is pressed. With the keys ZERO/SELECT the desired function can be selected and with ENTER it will be started. If during 10 seconds no further key is operated, the function list will be left. With the key SEND/ESC a function selected can be abandoned. Already entered changes of parameters will be rejected and the BlueLEVEL-2D will return to the previously used display mode.

Here after the single functions will be described.

3.1 "ZERO-SETTING" / ABSOLUTE ZERO

Absolute ZERO means that the instrument shows the measuring value "0" if the measuring surface of the instrument is aligned exactly according to gravity (true horizontal or true vertical).

3.1.1 SET ABSOLUTE ZERO (WITH A REVERSAL MEASUREMENT)

The absolute zero is used as the base for <u>absolute inclination</u> measurements. In order to achieve the best possible precision please observe that the measuring object (support) and the BlueLEVEL-2D have the same temperature and that the instrument is in operation for several minutes before starting a measurement. The surface needs to have a very good flatness.

Mark the precise position and particularly the direction of the BlueLEVEL-2D in order to be able to turn the instrument by 180 degrees and to put it in opposite direction at the very same spot.



Measurement "A"

Turning the instrument at the same spot by 180°

Measurement "B"



The absolute zero will be determined from a reversal

direction but at the same spot). Use for this procedure

an adequate surface (rigid and stable support, as flat as possible and as horizontal as possible), where you put the BlueLEVEL-2D. Mark the position and the direction of the BlueLEVEL-2D precisely and turn it on

measurement (two measurements in opposite

The "ZERO-OFFSET" will be stored in the BlueLEVEL-2D

the same spot by 180 degrees.

EXAMPLE:

In the display the position of the instrument for the first measurement will be shown.

Put the BlueLEVEL-2D to the first position and press the key <u>ENTER</u> for reading the first measuring value. Alternatively the first measuring value can also be entered with the zapper.



During the measurement the display will graphically show the current measurement.

Confirm the first measurement with the key **ENTER** or with the zapper. After 15 seconds the value will automatically be read.

After a successful reading of the first measuring value the position of the instrument for the second measurement will appear in the display.

Put the BlueLEVEL-2D now to the second position (turn the instrument by 180 degrees in the horizontal) and press the key <u>ENTER</u> again for reading the second measuring value. Alternatively the second measuring value can also be entered with the zapper.

During the measurement the display will graphically show the current measurement.

Confirm the second measurement with the key **ENTER** or with the zapper. After 15 seconds the value will automatically be read.

After termination of the reversal measurement the display for the actual measurement under consideration of the ZERO OFFSET will appear on the screen.







ABS 27

± 0.996

Notice:

The value of the "ZERO OFFSET" determined by a reversal measurement corresponds to the deviation of the zero point of the BlueLEVEL-2D compared to the absolute Zero (gravity). The displayed measuring value corresponds to

VALUE displayed =

Value of the BlueLEVEL-2D minus "ZERO OFFSET"

The reversal measurement described above should be repeated periodically in order to a chieve a high measuring precision, particularly when the BlueLEVEL-2D has not been in use for a longer period.

3.2 SELECTION OF THE MEASURING UNIT / UNIT

3.2.1 STANDARD-UNITS

You can change the measuring unit of the inclination values displayed. If you start the function [UNIT] the list of the available measuring units will appear. With the keys $\overline{ZERO/SELECT}$ $\Phi = 0$ you can now select the measuring unit preferred. For memorizing the measuring unit selected you press now the key ENTER . The measuring unit will remain active until you change it again according to the above procedure.

XXXX.XX	mm/m	mm per m / 2 decimals
XXX.XXX	mm/m	mm per m / 3 decimals *
XX.XXXX	"/10"	inch per 10 inches / 4 decimals
XX.XXXX	"/12"	inch per 12 inches/ 4 decimals
XXXX.XX	mRad	Milliradian / 2 decimals
XXX.XXX	mRad	Milliradian / 3 decimals
XXXX.XX	mm/REL	mm in relation to the relative base / 2 decimals
XXX.XXX	mm/REL	mm in relation to the relative base / 3 decimals *
XX.XXXX	"/REL	inches in relation to the relative base / 4 decimals
XXXX.XX	Α ‰	artillerie-permille
XXXX.XX	‰	permille
xxx.xxx°	DEG	degrees/3 decimals
xxx° xx'	DEG	degrees/minutes
xx° xx' xx"	DEG	degrees/minutes/seconds
XXXX'XX"	DEG	minutes / seconds
XXXXXX"	DEG	seconds
XXXXX.X"	DEG	seconds *
XXX.XXX	GON	gon / 3 decimals
XX.XXXX	GON	gon / 4 decimals

The following measuring units can be chosen.

Depending on the unit selected the last digit will be rounded to 5" or to the nearest lower integer (e.g.20 µmm/m).

3.2.2 UNITS WITH RELATIVE BASE LENGTH

The units mm/REL and "/REL are related to a relative, this means selectable, base length. After selecting one of these units, the relative base length must be entered.

Example: mm/REL / mm in relation to a relative base / 2 decimals.

1000 After the selection of the measuring unit in our example the stored base length of 1000 mm will appear. Rel. Base mm With the keys ZERO/SELECT The proposed base length can be modified. The newly entered value can finally be confirmed with the **ENTER** key. 1250 With the key <u>ON/MODE</u> the default value 1000 mm will be recalled. Rel. Base mm The following measurements are now related to a base length of 1250 mm.

When measuring in the "relative mode" the height "X" will be displayed as linear measure in the selected unit and in relation to the set base length (in **mm** or **inches**).



3.3 FUNCTION HOLD

The key function HOLD + can be applied in all measuring modes.

Put the BlueLEVEL-2D on a stable support. Press now the key HOLD . While the BlueLEVEL-2D is waiting for a valid measuring value the display will show graphically the measuring values read in the form of a shoal of points. As it is practically impossible to obtain a valid measuring value during manipulation, the instrument can be set to the final position even after activating the key.

Complete the measurement with the <u>ENTER</u> key or with the zapper. After 15 seconds the measuring value will automatically be read.

By pressing the key \bigcirc HOLD \bigcirc again a new valid measuring value will be read.

With the key SEND/ESC the "frozen" measuring value will be transmitted via the "**RS485**" port to a connected PC/Laptop with an RS232 interface. At the same time the instrument will return to the measuring mode.

The function SEND can also be initiated from the PC/Laptop connected by sending "P" (as a letter) via the RS 232 port.







3.4 SELECTION OF THE FILTER UNDER DIFFERENT MEASURING CONDITIONS / FILTER

A number of different predefined filters can be selected.

Description of the different filter types:

- FILTER 1: No filtering, no integration of the measuring values (T const. = 0.33 sec.)
 FILTER 2: Floating average of 3 measuring values (T const. = 1 sec.)
- FILTER 3: Floating average of 15 measuring values (T variable = 0.33 ... 5 sec.)
- FILTER 4: Floating average of 6 measuring values (T const. = 2 sec.)
- FILTER 5: Floating average of 15 measuring values (T const. = 5 sec.)

T: Response time when changing the position. For filter 3 the actual change of the measuring value will define the number of values to be used for calculating the floating average. With a considerable change the number of values will be reduced with minute fluctuations the number will be increased.

Filter type 3 is the factory setting when leaving WYLER AG.

With the key <u>ON/MODE</u> select the menu item [FILTER] and	
confirm this selection with ENTER .	





The measuring instrument will return to the measuring mode.

3.5 ABSOLUTE MEASUREMENT / RELATIVE MEASUREMENT

3.5.1 ABSOLUTE MEASUREMENT

As a factory setting the BlueLEVEL-2D will be programmed for absolute measurement (default setting).

If this is not the case select the function [Absolute]. After confirming this function with the key <u>ENTER</u> the instrument is ready for measurements in the mode "ABSOLUTE".

The measuring value corresponds to the



Inclination X: 0.996mm/m Inclination Y: 4.311mm/m

3.5.2 RELATIVE MEASUREMENT / REL ZERO

Important preliminary remark:

The "REL ZERO OFFSET" determined for a relative measurement will be superposed to the "ZERO OFFSET", e.g. determined by a reversal measurement.

The "REL ZERO OFFSET" will be stored in the BlueLEVEL-2D and can be re-called again and again. When starting the next relative measurement the "REL ZERO OFFSET" entered or determined the last time will be displayed. The value can either be confirmed, newly entered or set to zero.



Set the BlueLEVEL-2D to the correct position and press the key <u>RELZERO</u>

After 15 seconds the value will automatically be read.

During the measurement the display will graphically show the current measurement.

Complete the measurement with the <u>ENTER</u> key or with the zapper. After 15 seconds the measuring value will automatically be read.

On the screen now the display for the actual measurement will appear under consideration of the ZERO OFFSET.

Inclination X: 0.000mm/m Inclination Y: 0.000mm/m





The **value** displayed **is** "**0**" and represents the position of the reference defined.



3.6 MEASURING WITH LIMITS / LIMITS

If you intend to set off an "Alarm" when a defined limit is exceeded this can be realised using the function "LIMITS".

The function "LIMITS" allows defining an upper and a lower **limit**. If this set limit is exceeded respectively under-run, a horizontal bar in the display will start blinking. A blinking bar above the displayed value means that the upper limit has been exceeded. If the blinking bar is below the lower limit has been under-passed. Through the RS485 port a message will be sent.



The measuring instrument will return to the measuring mode.

If during the measurement the lower respectively the upper limit is exceeded a blinking horizontal bar will appear above respectively below the inclination value. Via the RS485 port a respective message will be sent.

It is possible to set the lower limit above the upper limit. In this case a respective message will be sent via the RS485 port continuously.

Data format at the RS 485 interface Upper Limit [SSS XXXXXtt UL sn.nnnnn sm.mmmmmm<cr>] Lower Limit [SSS XXXXXtt LL sn.nnnnn sm.mmmmmm<cr>] SSS =0 .. 255 - Laufnummer xxxxxtt = Sensor Serial Number and Type N2673Dx BlueLEVEL-2D X-Axis N2673Dy BlueLEVEL-2D Y-Axis sn.nnnnn = +9.999999 - Positive Overrange -9.999999 - Negative Overrange other value - angular value in rad e.g. +0.226349 limit defined sm.mmmmm =



Limits



3.7 GROUPING OF INSTRUMENTS TO A MEASURING GROUP IN THE WIRELESS MODE

3.7.1 GROUPING VIA CABLE CONNECTION / JOIN

 Connect all instruments to be grouped (BlueLEVEL-2D and e.g. a BlueMETER SIGMA or BlueTC) using the cables provided and switch all instruments on.



- 2. Select on the BlueMETER the menu "JOIN" using the <u>ON/MODE</u> key. Confirm with the key <u>ENTER</u>. All instruments connected are now searched and joined to a group.
- 3. After establishing the group a "REFRESH" will be performed.
- 4. After a successful grouping on both instruments the green LED "READY" will blink shortly as many times as instruments are joined in the measuring group (including the own address).
- 5. For using the wireless mode (the wireless mode must be switched-on on each instrument) the cables can now be removed. After removing the cables the measuring values will be "freezed" for a short while and replaced by empty zeroes until, after successful connection, the measuring values will be displayed again.
- 6. After successful connection the blue LED "LINK" will be lighting on all the instruments connected.

3.7.2 GROUPING IN THE WIRELESS MODE / JOIN

With the function "JOIN" an instrument can be added to an existing group. During this procedure no instrument must be connected by cables as otherwise the "JOIN" procedure for cables will be performed. To make sure that the instrument does not belong to another group, it is advisable to perform the function "LEAVE" first.

1. On the BlueLEVEL-2D select the menu "JOIN" using the ON/MODE key. Confirm with



Set the second instrument also to the JOIN mode.

2. Searching

The two instruments are "searching" each other. During the searching procedure the green LED on both instruments is lit continuously. The instruments remain in the "search" mode until they have detected each other.

During the search process the following picture will be displayed:



Remark: The searching process may go on for several minutes in bad communication conditions.

3. Group connection

As soon as the two instruments have successfully detected each other the search process is stopped and this is visualised by a rapid blinking (4 to 5 times per second) of the green LEDs on both instruments. The joining can now

- be activated by using the **ENTER** key on one of the instruments or
- the whole process may be cancelled by pressing the $\frac{ON/MODE}{A}$ key.

If the LED "OFF" is blinking in red, a grouping is not possible (see chapter 3.7.3 / special case)

4. The green LED "READY" will blink shortly as many times as instruments are joined in the measuring group (including the own address).

3.7.3 SPECIAL CASE "JOIN"

In case both instruments are already joined in different groups of instruments they do find each other but they can not communicate together. The red LED "OFF" is blinking. The search process may be cancelled by using the key <u>SEND/ESC</u>.

If it is required to use one of the instruments in the new measurement group it is necessary to use the mode "LEAVE" to cancel the existing connection.

3.7.4 UNHINGE AN INSTRUMENT FROM A GROUP USING THE FUNTION "LEAVE" / LEAVE

Each instrument may be unhinged individually from an existing measuring group.

PROCEDURE "LEAVE"

- 1. On the BlueLEVEL-2D select the menu "LEVAE" using the ON/MODE key.
- 2. The BlueLEVEL-2D is now unhinged from the group and is no longer accessible via wireless data transmission.

3.8 TEACH-IN of the IR-trigger (Zapper)

In order to eliminate interference of the zapper signals when several measuring groups are active in the triggering range the IR trigger can be assigned to a specific measuring group by applying the function TEACH-IN

Procedure **TEACH-IN**:

- The measuring or display instrument must be started.
- Keep one of the keys V V C on the measuring or display instrument pressed
- Point the trigger (IR Zapper) in the direction of the measuring or display instrument
- Press the actuator key on the IR Zapper until both red IR LED's are lighting up.

This procedure must be done on all the measuring and display instruments using the same IR triggering. When the instruments are dispatched this procedure is already factory set standard.



4 OPTIONS

The options serve for entering the basic adjustments of the measuring instrument. The access to the options can be protected with a PIN code in order to avoid unauthorised modifications.

The following options are available:

- Option "Set PIN-Code" With this option it is possible to block the entering of options with a PIN code.
- **Option "Display Settings"** With this option basic settings of the display, such as the brightness and colour pattern, are possible.
- **Option "Logscale"** With this option the logarithmic scaling can be switched on or off.
- Option "Programmable Keys" With this option it is possible to switch the scale-functions of the keys <ZERO/SELECT> and the functions of the key <ON/OFF> on or off.
- Option "Functions ON/OFF" With this option specific functions can be switched on or off. Functions switched off will no longer appear in the main menu.
- Option "Hide disabled Functions ON/OFF" If this option is enabled, disabled functions will not be shown.
- Option "Radio ON/OFF" With this option the wireless data transmission can be activated or deactivated.
- Option "Gravity"

With this function the correction of the gravitation can be switched on or off and the local gravity force can be entered.

Option "Version"

With this option the version of the firmware will be displayed.

• Option "Factory Reset"

A complete factory reset will set the instrument to the factory (default) settings as it has been configured at the factory. All personal settings are lost.

• Option "Self Test"

A function check of the instrument will be performed.

4.1 SET PIN-CODE

In order to protect the settings of the BlueLEVEL-2D against unauthorised changes you have the possibility to block the entering of options with a PIN code.

Using the key <u>ON/MODE</u> select the menu point [Options] and confirm with <u>ENTER</u> . Select now [Set Pin Code] and confirm with <u>ENTER</u>	
Switch the blocking of options with the keys $\boxed{ZERO/SELECT}$ $$ to ON and confirm with the key \boxed{ENTER} .	OFF
You can now enter your PIN code. The value can be adjusted using the keys ZERO/SELECT $\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \$	00000

The measuring instrument will change back to the measuring mode.

If the option PIN code is activated, the code must be entered before the list of options will be shown.

Entering the PIN code: The value can be adjusted using the keys ZERO/SELECT	00000
	PIN ?

As a factory setting the PIN code is deactivated. The default value is 00000.

4.2 DISPLAY SETTINGS

The brightness of the display, the brightness in the energy safe mode and the colour pattern can be adjusted individually. The BlueLEVEL-2D will work in the energy safe mode as long as no external power supply is connected and it is powered by batteries. The brightness is indicated as a percentage of the maximum brightness. As the power consumption is considerably reduced with a reduced brightness, it is recommended to use in the energy safe mode a brightness of 50 % (default). With the colour pattern the background colour can be adjusted. The colour of the fonts changes according to the brightness of the background between white and black. Standard background is blue.

Using the key ON/MODE	
confirm with ENTER	
confirm with ENTER	

select the menu point [Options] and Select now [Display Settings] and

With the keys ZERO/SELECT Select the display option you would like to change and confirm the selection with the key

In the brightness adjustments you can increase or reduce the brightness using the keys ZERO/SELECT . The range is from 10% to 100%.

With the key ON/MODE the default value of 50% will be recalled.

Confirm the new value with the key

Display Settings > Brightness Brightness Battery Color 50 Brightness %



The measuring instrument will return to the measuring mode.

In the colour adjustments you can select the colour preferred using the keys $\angle ZERO/SELECT / 2 - Confirm$ your choice with the key

4.3 LOGSCALE

ENTER /

With this option the logarithmic scaling can be switched on or off.

Using the key <u>ON/MODE</u> select the menu point [Options] and confirm with <u>ENTER</u>. Select now [Logscale] and confirm with <u>ENTER</u>

Switch the logarithmic scaling ON or OFF using the keys $\boxed{\text{ZERO/SELECT}} \bigoplus \boxed{}$ and confirm with the key $\boxed{}$ ENTER $\boxed{}$



4.4 PROGRAMMABLE KEYS

The function of the keys $\boxed{\text{ZERO/SELECT}}$ 2 as well as the key $\boxed{\text{RELZERO}}$ can be switched on or off.

Programmable Keys

- Rel.Zero {ON}

- Scale {ON}

ON

> Ok

.

🛧 🦊 - Scale

> Ok

A.

Programmable Keys

- Rel.Zero {ON}

- Scale {ON}

Using the key ON/MODE select the menu point [Options] and confirm with ENTER. Select now [Programmable keys] and confirm with ENTER

Select the key you want to activate or deactivate using the keys ZERO/SELECT
and confirm your choice with the key

With the keys ZERO/SELECT V you can switch the selected key ON or OFF. In the display the selected status will be shown. ON means activated, OFF means deactivated. Confirm with the key ENTER.

The list of the programmable keys will be shown again. For switching another key on or off, repeat the procedure as described above. In order to store the settings select "Ok" and confirm with the key <u>ENTER</u>.

4.5 FUNCTIONS ON/OFF

The menu functions provided can be switched on respectively off. Thus the menu displayed can be adjusted to the needs of the user.

Using the key <u>ON/MODE</u> select the menu point [Options] and
confirm your selection with ENTER . Select now [Functions
ON/OFF] and confirm with

Select the function you want to switch on respectively off with the keys ZERO/SELECT and confirm your selection with the key <u>ENTER</u>

With the keys ZERO/SELECT & you can switch the selected function ON or OFF. In the display the selected status will be shown. ON means enabled, OFF means disabled.

The list of the switchable functions will be shown again. For switching another function on or off, repeat the procedure as described above.

In order to store the settings select "Ok" and confirm with the key

Functions ON/OFF > Ok Absolute {ON} Rel.Zero {ON} Display {ON} Unit {ON} Abs.Zero {ON} Limits {ON} Filter {ON} Join {ON} Leave {ON}			
ON			
Functions ON/OFF > Ok Absolute {ON} Rel.Zero {ON} Display {ON} Unit (ON)			
Abs.Zero {ON} Limits {ON} Filter {ON} Join {ON}			

The measuring instrument will return to the measuring mode.

4.6 HIDE DISABLED FUNCTIONS ON/OFF

This adjustment allows you to hide the functions disabled. The list of functions will only show those functions which are enabled. If this adjustment is not activated, disabled functions will be shown in the list of functions in grey fonts.

Using the key ON/MODE select the menu point [Options] and confirm your selection with ENTER Select now [Hide disabled Functions ON/OFF] and confirm with ENTER



Switch the adjustment "Hide disabled functions" ON or OFF with the keys $\angle ZERO/SELECT / 2 = and confirm with the key <math>\angle ENTER / =$.

4.7 RADIO ON/OFF

This adjustment allows you to switch the wireless data transmission on or off.



4.8 GRAVITATION

The inclination displayed by the BlueLEVEL-2D is based on the gravitation. Around the globe the gravitation is, however, not constant but it varies with the latitude and with the height above sea level. Furthermore variations of the density in the lithosphere cause additional local deviations.

As an example the gravity at sea level is

- 9,78033 m/s² at the equator ,
- 9,80620 m/s² at 45 degree of latitude,
- 9,83219 m/s² at the poles.

In the table to the right the values of gravity for some cities are listed. The BlueLEVEL-2D has been calibrated at the head office of WYLER AG. The inclinations displayed are exact only in this location. In different places the displayed value must be corrected. If the

Amsterdam	9.813	Istanbul	9.808	Paris	9.809
Athens	9.807	Havana	9.788	Rio de Janeiro	9.788
Auckland, NZ	9.799	Helsinki	9.819	Rome	9.803
Bangkok	9.783	Kuwait	9.793	San Francisco	9.800
Brussels	9.811	Lisbon	9.801	Singapore	9.781
Buenos Aires	9.797	London	9.812	Stockholm	9.818
Calcutta	9.788	Los Angeles	9.796	Sydney	9.797
Cape Town	9.796	Madrid	9.800	Taipei	9.790
Chicago	9.803	Manila	9.784	Tokyo	9.798
Copenhagen	9.815	Mexico City	9.779	Vancouver, BC	9.809
Nicosia	9.797	New York	9.802	Washington, DC	9.801
Jakarta	9.781	Oslo	9.819	Wellington, NZ	9.803
Frankfurt	9.810	Ottawa	9.806	Zurich	9.807

correction of the local gravity is switched on, the inclination measured will be corrected accordingly before the value is displayed.

The correction is calculated according the following formula:

$$\alpha_{eff} = \arcsin\left(\frac{g_c}{g_m}\sin(\alpha_m)\right)$$

whereas

- g_c gravity at the place of calibration
- α_m displayed angle at place of measurement
- g_m gravity at the location of measurement
- α_{eff} effective angle

In order to switch the correction of the local gravity on respectively off, proceed as follows:

Using the key ON/MODE select the menu point [Options] and confirm your selection with ENTER. Select now [Gravity] and confirm with ENTER.



The measuring instrument will return to the measuring mode.

4.9 VERSION FIRMWARE

With this option information about the firmware installed and the configuration can be displayed.

Using the key <u>ON/MODE</u> select the menu point [Options] and confirm your selection with <u>ENTER</u>. Select now [Version] and confirm with <u>ENTER</u>.

The following information will be displayed:

- Serial number of the instrument
- Number of the Firmware
- Release date of the Firmware
- Type of the instrument (Wireless / Cable)
- Version of the Bluetooth module
- Serial number of the integrated sensor
- Measuring range

With the key **ENTER** this display will be left.

Device SN	P0701
Firmware	269
Date	10.10.2012
Type	Wireless
Bluetooth	3.7.0
Sensor SN	Sensor X SN: P8713 Sensor Y SN: P8719

A complete factory reset will reset the instrument to the state as it has been configured at the factory. All personal settings are lost.

The BlueLEVEL-2D will be set to the following standard configuration:

Standard-Values:	
measuring mode:	absolute
measuring unit:	DEC xx°xx'xx"
relative base:	1000 mm
absolute Zero point (ZERO-OFFSET):	0
relative Zero point (REL ZERO-OFFSET):	0
Filter	No. 3
Display	numeric display
Limits	OFF
Upper Limit	0
Lower Limit	0
Scale	maximum range
Join	not joined
Pin Code	OFF; Code = 00000
Display Settings	Colour Blue;
	Saturation 100%;
	Saturation Power Save 50%;
Logscale	OFF
Programmable Keys	all keys enabled
Functions	all functions enabled
Hide disabled Functions	OFF
Radio	ON, if available
Gravitation	OFF; value = 9.807 kg⋅m/s2

Using the key <u>ON/MODE</u> select the menu point [Options] and confirm your selection with <u>ENTER</u>. Select now [Factory Reset] and confirm with <u>ENTER</u>.

In order to prevent a resetting by error the question "Are you sure?" will appear. If you really want to delete all personal settings, press now the key **ENTER**.

After 10 seconds or with the key SEND/ESC the instrument will return to the measuring mode.



4.12 FUNCTION CHECK

At the start of the instrument a system test will be performed, checking the most important functions. In addition to this test the functions of the keys and of the LEDs can be checked.

Using the key <u>ON/MODE</u> select the menu point [Options] and
confirm your selection with <u>ENTER</u> . Select now [Self Test]
and confirm with ENTER

In the display a simplified design of the front foil of the BlueLEVEL-2D will be shown. If any key or the IR zapper is pressed, the real LEDs as well as those on the display will lit. In addition the key pressed will be marked. Each key will create an individual pattern. Thereby the real LEDs and those on the display must be identical. If this is not the case, either a key or an LED is defective.

After 10 seconds without activating any key the instrument will leave the function check mode.



	☆ △ ◇ □ ◇ ○
Self Test	

APPENDICES

A FLOAT CHARTS GENERAL

A1 START THE INSTRUMENT / ON/OFF

POWER UP / Switch on instrument



page 37 of 65 pages

A2 KEY REL.ZERO



A3 Key HOLD, FREEZING OF A MEASURING VALUE / HOLD





A5 ADJUSTMENT OF THE DISPLAY / DISPLAY



A6 MEASUREMENT ABSOLUTE / MODE ABSOLUTE











A11 ADJUSTMENT OF FILTER TYPES / FILTER





A13 LEAVING A GROUP OF INSTRUMETNS / LEAVE



B FLOAT CHARTS OPTIONS

B1 PIN-CODE-QUERY FOR ACCESS TO THE OPTIONS









B5 PROGRAMMABLE KEYS "REL ZERO" AND "ZERO/SELECT" / PROGRAMMABLE KEYS





B7 SWITCHING THE HIDING OF DISABLED FUNCTIONS ON OR OFF / HIDE DISABLED FUNCTIONS ON/OFF













C Error Messages

After the start of the instrument the BlueLEVEL-2D performs a function check. If any defects are detected the instrument must be returned to the distribution partner. A proper functioning can not be guaranteed. The following error messages may appear:

Display is blinking grey mottled.		Programme memory is defective
Display blinks two times grey mottled		Display error
ERROR 1	General instrument de	efect
ERROR 2	No calibration data available	
ERROR 3	Sensor not found	
ERROR 4	Bluetooth not found	
ERROR 5	Defective Flash memory	
ERROR 6	Defective EEPROM	

D MAINTENANCE

D.1 GENERAL

The BlueLEVEL-2D needs no special service other than the regular cleaning.

D.2 STORAGE/ CARE AND HANDLING OF THE BATTERIES



For storage periods the measuring instrument should be placed in a position in which the instrument is also used when measuring (upright position).

Read the instructions in your manual before installing batteries. Make sure to insert the batteries properly, following the symbols showing you the correct way to position the positive (+) and negative (-) ends of the batteries. Keep battery contact surfaces clean by gently rubbing with a clean pencil eraser or cloth. Replace batteries with the size and type specified by the device's manufacturer. Remove all used batteries from the device at the same time, then replace them with new batteries of the same size and type. Store batteries in a cool, dry place at normal room temperature. Remove batteries from devices that will be stored for extended periods. Don't dispose of batteries in a fire - they may rupture or leak. Don't recharge a battery unless it is specifically marked "rechargeable." Attempting to recharge a normal battery could result in rupture or leakage

Operating temperature (min/max): 0°C ... +40°C relative humidity: max. 85%

D.3 SPARE PARTS / ACCESSORIES

The following spare parts are available:

- Batteries, NC-accumulators
- various cables
- Infra-red Zapper

E CONFORMITY DECLARATIONS AND APPROVALS

All documents relating to

- Declaration of Conformity "DoC"
- FCC Compliance, Statement for cB-0946
- IC Compliance
- Japan Radio Equipment Compliance (TELEC)
- Batteries / WEEE

can be found on our website WYLER AG, http://www.wylerag.com/en/support/certificates/

F SERVICE AND REPAIR

F1 REPAR OF MEASURING INSTRUMENTS AND DISPLAY UNITS

Normally any instruments requiring repair can be sent to the local WYLER partner (local distributor) who will take the necessary steps and make the arrangements for repair on behalf of the customer.

Express Repair Service, ERS

A large number of customers can not miss the instruments for a longer period as these are in daily operation. For these cases WYLER SWITZERLAND has created a new service called "Express Repair Service, ERS". Employing this service the transport time from the user to WYLER SWITZERLAND and back and thus the complete repair time can be reduced considerably.



A simplified description of this service:

- The customer announces the repair request to the local WYLER partner in his country.
- The WYLER partner will inform the customer about the possibility of the ERS service outlining the advantages and consequences of this service, such as e.g.
 - o reduced total repair time
 - required acceptance to repair without quote up to 65 % of the price for a new instrument
 - suitable packing for air transport
 - expenses of the ERS
- In case the customer decides to use the ERS, the customer informs the local WYLER partner or directly WYLER SWITZERLAND providing the necessary data.
- The customer will receive all information and instructions necessary for a smooth handling, the customer has just to pack the product suitably and to fill in a form for the **TNT courier service** as well as to announce the readiness to the local TNT office for pick-up. Everything else will run automatically.
- Products reaching WYLER SWITZERLAND under this service will be handled with first priority, and the instrument will be returned using the same carrier.
- The invoicing will be through the WYLER partner in your country.

Please do not hesitate to make use of this service in order to have your WYLER instrument back at your disposal as soon as possible. In case of any questions please contact WYLER SWITZERLAND or your local distributor, we will gladly help you to use the ERS successfully.

F2 SERVICE - AND MAINTENANCE CONTRACTS

Measuring systems are becoming more and more complex and are therefore subject to continuous supervision in respect of quality and reliability. For this purpose WYLER AG offers the option of a MAINTENANCE CONTRACT with the purchase of new instruments.

Such a MAINTENANCE CONTRACT offers the following services to the customer:

- Complete inspection and re-adjustment of the instrument / system in a bi-yearly interval.
- The scope of delivery includes an internationally recognised Calibration Certificate SCS for the entire system confirming the performance after the service intervention. Traceable certificates SCS are issued according to our accreditation as a calibration laboratory by the Swiss authorities
- Highest priority for any repair works (actual repair work is not included and will be quoted separately)
- Technical enhancements and modifications published by WYLER, if considered suitable
- Costs for packing and transport of the instrument(s) from the customer to WYLER and back, either directly or through the WYLER distribution partner
- Extension of warranty period to 24 months: If a maintenance contract is signed within 6 months of the purchasing of a new instrument the warranty period is extended to 24 month.

Options:

Depending on the customers requirement the re-calibration interval can be shortened (every year) or be extended (every 3rd year)

The following services are **excluded** from all maintenance contracts:

• The contract does not include any repair work. If it is determined during the inspection or the re-calibration process that the instrument requires repair, such work will be quoted separately to the customer.

We help you to keep your valuable and important instruments always accurate and ready for use! We would be glad to offer you a maintenance contract adapted to your specific requirements.





WYLER AG Im Hölderli CH-8405 WINTERTHUR Switzerland Tel. 0041 (0) 52 233 66 66 Fax. 0041 (0) 52 233 20 53

Homepage: http://www.wylerag.com E-Mail: wyler@wylerag.com